


4-H2O2-100 HYDROGEN PEROXIDE SENSOR 0-100PPM H2O2



Outline Dimensions

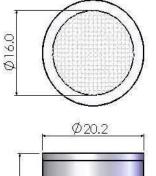

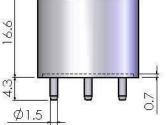

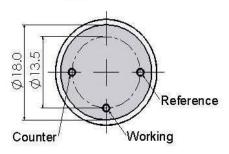

All dimensions are in millimeters. All tolerances are ±0.2mm.

Note: PCB sockets are recommended for the sensor pin connection. Soldering to the sensor should be avoided and will invalidate warranty.

All performance specifications are based upon the following environment conditions: +20°C, 50% relative humidity and 1 atm (1013 mBar or ambient pressure).

SPECIFICATION – 4 SERIES

Operating Principle:	Electrochemical, 3-electrode cell	
Gas Detected:	Hydrogen Peroxide H2O2	
Measurement Range:	0 – 100 ppm	
Resolution:	0.05 ppm	
Expected Operating Life:	24 months in air	
Temperature Range:	-20°C to +40°C	
Humidity Range (non-condensing): 15 – 90% RH		
Response Time (T90):	≤ 60 seconds	
Long Term Sensitivity Drift:	< 2% signal per month	
Linearity at Standard Range:	Linear	
Sensitivity:	150 +/- 50 nA/ppm	
Repeatability:	< +/- 2% signal	
Pressure range:	800 to 1200 mbar	
Bias Potential:	0 mV	
Recommended Load Resistor: $5 \sim 30 \Omega$		
Warranty Period:	18 months from date of manufacture	
Storage Life:	6 months in sealed container	
Storage Temperature:	0°C to +20°C	
Weight (approx):	5 g	
Orientation Sensitivity:	None	
Part Number:	2112B21510214	



4-H2O2-100 HYDROGEN PEROXIDE SENSOR 0-100PPM H2O2

CROSS SENSITIVITY DATA

Gas	Concentration (ppm)	Output Signal (ppm H2O2 equivalent)
Carbon Monoxide CO	200	3
Methane CH4	5000	0
Nitric Oxide NO	20	-0.5
Sulphur Dioxide SO2	20	15

Notes: Calibration with cross-sensitivity gas is not recommended. It is recommended to calibrate an instrument using the target gas for accurate measurements.

Cross-sensitivities are supplied as a guidance only and do not form part of the product or datasheet specification.

Cross-sensitivities may fluctuate between +/- 50% and may show significant variation from batch to batch and within the sensor's lifetime. Values quoted are based on tests conducted on a small number of sensors and any batch may show significant variation. The cross-sensitivities are including but not limited to the above gases. The sensor may also respond to other gases and may behave differently with changes in application and environmental conditions.

Notes: Sensors are designed to operate in a wide range of harsh environments and conditions. However, it is important to avoid exposure to high concentrations of solvent during storage, fitting into instrumentation and operation. When using sensors on PCBs, degreasing agents should be used prior to the sensor being fitted.

By the nature of the technology used, any sensor can potentially fail to meet specification without warning. Euro-Gas makes every effort to ensure reliability of all sensors but where life safety is a performance requirement of the product and, where practical, Euro-Gas recommends that all gas sensors and instruments using sensors are checked for response to gas before use.

The data contained in this document is believed to be accurate and reliable. The data given is for guidance only. Euro-Gas Management Services Ltd accepts no liability for any consequential losses, injury or damage resulting from the use of this datasheet or the information contained in it. Customers should test the sensors under their own conditions to ensure that the sensors are suitable for their own requirements and in accordance with the plans and circumstances of the specific project and any standards/regulations pertaining to the country in which the sensors will be utilised.

Performance characteristics on this data sheet outline the performance of newly supplied sensors. Output signal can drift below the lower limit over time. This datasheet is not intended to form the basis of a contract and in the interest of product improvement, Euro-Gas reserves the right to alter design features and specifications without notice. 06/21

EURO-GAS MANAGEMENT SERVICES LTD, CHURSTON HOUSE, BASCOMBE ROAD, CHURSTON FERRERS, DEVON, TQ5 0JJ, UK INT: 0044 1803 844414 sales@euro-gasman.com www.euro-gasman.com

